

## MODEL OM-25 BRIDGESENSOR



### Description:

The unit is a DIN Rail mount, self-contained DC powered module designed for load cell, strain gage, or single ended use. It contains a precision instrumentation amplifier, filtered output and a built-in 10VDC excitation supply capable of driving a 350 ohm bridge. The 0 to 30mV input range makes it compatible with most strain gage based load cell or pressure transducer outputs. It provides an output of 0 to 10VDC. Connections are made via easily accessible screw clamp terminal blocks. Zero and Span adjustment potentiometers are located externally as well for easy access. Contact the factory for additional gai} /output options.

### Features:

- Low Cost
- Din Rail Mount
- Load Cell or Single Ended Application
- 0-30mVDC Input
- 0-10VDC Output

Amplifier	
Gain Adjustment Range Input for 10VDC Output	333 to 1000 10mV to 30mV
Linearity: 0 to 10VDC Out	±0.01%
Zero Adjust	20% Max Output
Temperature Coefficient	0.05% / °C
Input Offset Voltage Temperature Coefficient	±70µV 0.7µV / °C
Common Mode Voltage	0 to +5 VDC
Common Mode Rejection - DC	100 dB
Input Noise 0.1Hz to 10Hz	0.3µV pp Typ
Output	
Output Range	0 to +10VDC
Load Current	2mA Max
Frequency Response 2 Pole Filter	DC to 10Hz
Total RMS Gain Temperature Coefficient	0.007% / °C

Bridge Supply	
Fixed Output	+10VDC ±1%
Temperature Coefficient	0.05% / °C
Load Current	30mA Max
Power Requirements	
Voltage	18 to 26 VDC
Input Current (1 - 350 Ohm Bridge)	40 mA
Environment	
Operating Temperature	0°C to +55°C
Storage Temperature	-40°C to +80°C
Size	
Size (Not including Universal Foot for standard DIN EN Rails)	1.65"H x 1.06"W x 3.78"L (42 x 27 x 96mm)
Weight	3 oz. (85g)
Agency Approval	
UL	UL508, C22.2 Pending

Load Cell Central follows a policy of continuous improvement and reserves the right to change specifications without notice. © 2015


**Load Cell Central**  
28175 Route 220  
Milan, PA 18831

Web: [www.800loadcel.com](http://www.800loadcel.com)  
Email: [sales@800loadcel.com](mailto:sales@800loadcel.com)


**Toll Free: 1-800-562-3235**  
Ph: 1-570-731-7048  
Fax: 1-570-731-7054

# MODEL OM-25 BRIDGESENSOR

## FULL BRIDGE CONNECTION

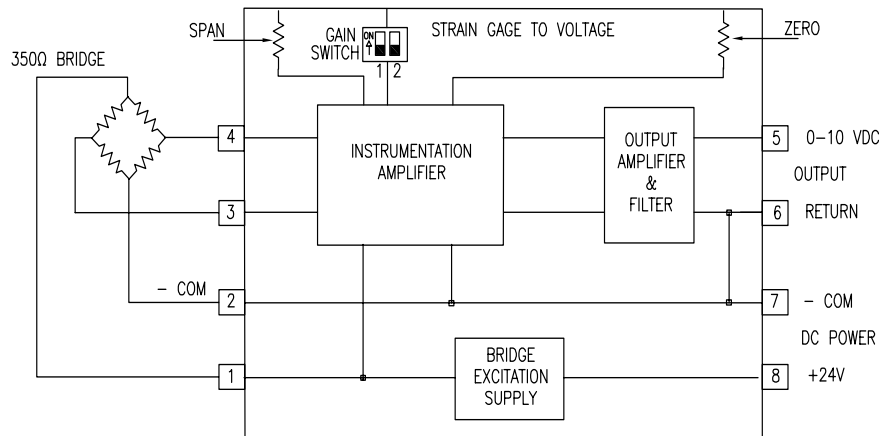

## SINGLE ENDED

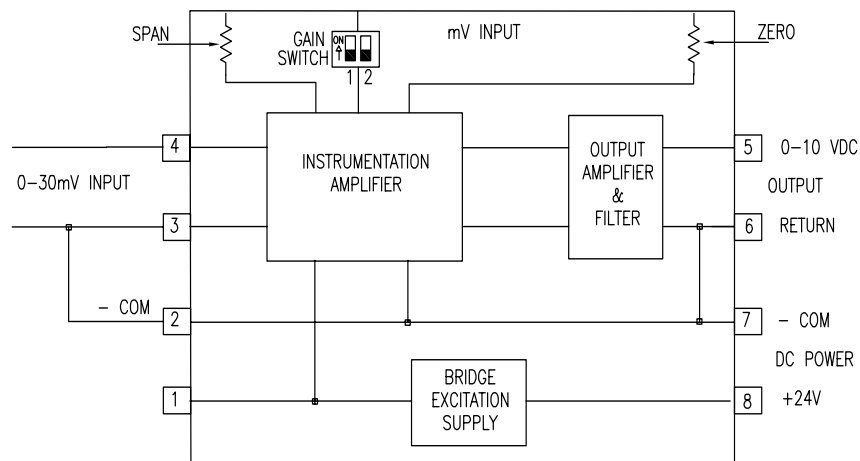

## Getting Started

### 1. Hook Up Procedure

- Connect the +out of the load cell to the +INPUT, pin 4.
- Connect the -out of the load cell to the -INPUT, pin 3.
- Connect the +excitation of the load cell to +EXCITATION, pin 1.
- Connect the -excitation of the load cell to -EXCITATION, pin 2.
- Connect the +24 VDC power supply to +24V, pin 8 and COM, pin 7.


### 2. Turn on Procedure

- Verify that the hook up procedure is complete.
- Turn on the +24 VDC power source connected to the 4710.

### 3. Calibration Procedure


- Jumper the +INPUT and the -INPUT terminals, pins 3 and 4, together.
- Check the Gain Switch Table, and set SW1-1 and SW1-2 to the expected full scale output of the load cell.

- Connect a voltmeter across the output, pins 5 and 6.
- Adjust the Zero Adjustment potentiometer for the desired output.
- Remove the jumper from the +INPUT and -INPUT terminals.
- With no load on the load cell, readjust the zero output.
- Apply a known load to the load cell; in most cases it would be 100% of full scale.
- Adjust the SPAN ADJUSTMENT potentiometer for the desired full scale output.
- Repeat steps F thru H until the desired settings are obtained.



SW1-1	SW1-2	FULL SCALE LOAD CELL INPUT
OFF	OFF	30 mV
ON	OFF	20 mV
ON	ON	10 mV

# MODEL OM-25 BRIDGESENSOR

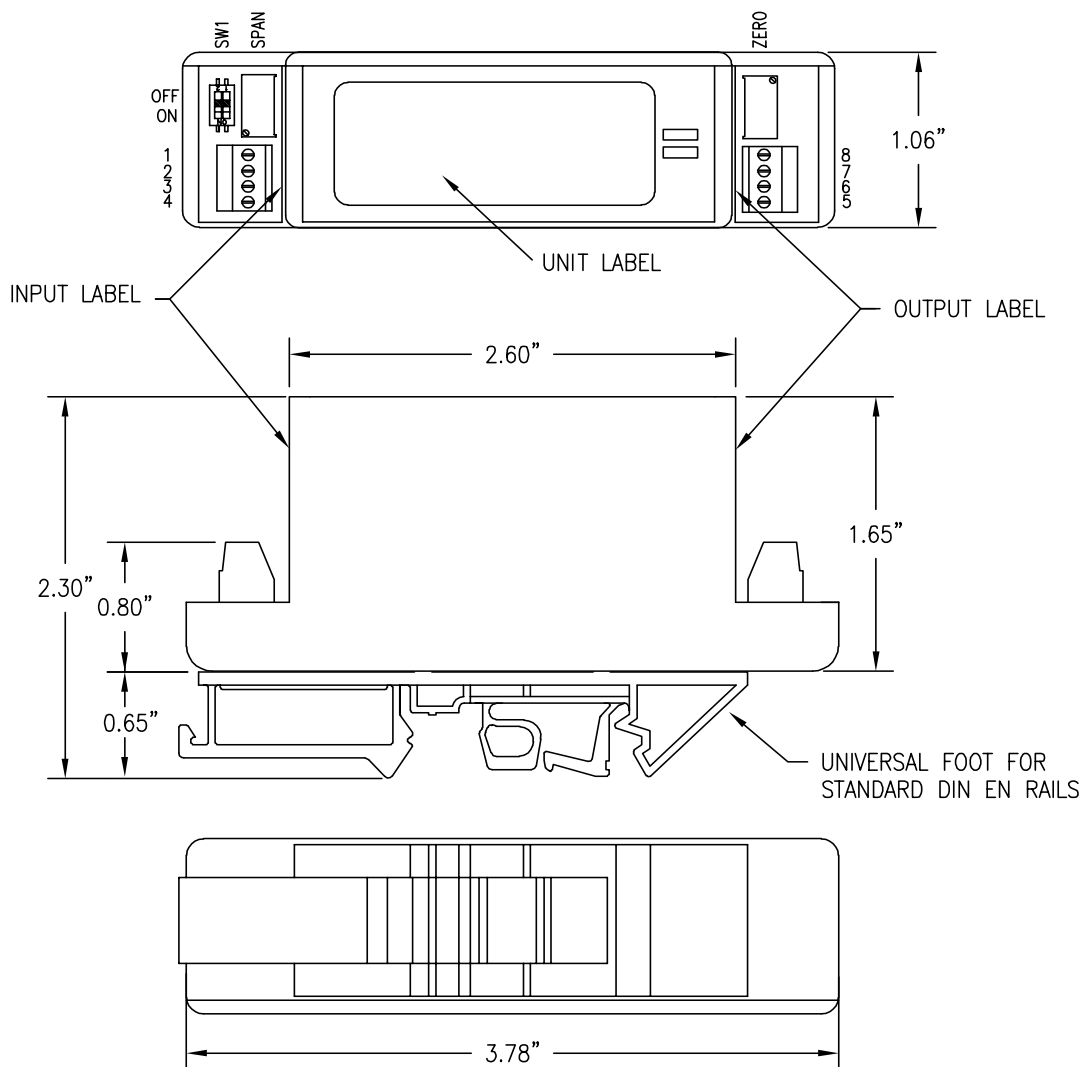

Mechanical tolerances unless otherwise noted:

X.XX dimensions  $\pm 0.020$  inches  
X.XXX dimensions  $\pm 0.005$  inches

TERMINAL	FUNCTION
SW1-1, SW1-2	GAIN SWITCHES
SPAN	SPAN ADJUSTMENT
1	+EXCITATION
2	- EXCITATION
3	-INPUT
4	+ INPUT

TERMINAL	FUNCTION
5	+ OUTPUT
6	COM
7	COM
8	+24V
ZERO	ZERO ADJUSTMENT